

Welltech Product Release Note

Date:20090504

Division:		Releaser:	Irene Ko
Model Name:	LP388	Object:	<input type="checkbox"/> H.W. <input type="checkbox"/> S.W.
Subject:	LP388sip_v104 Release		

Release contents

Bug Fixed

1. Failed to accept the consultant call with replace header when server hold is used.
2. Faked missed call was record, when consultant transferred call was received.
3. Improve session expires timers' algorithm.
4. No voice is happened during the conversation when music ring is used and volume key is pressed.
5. No voice is happened under the following call scenario:
 - A call B
 - C call B
 - B hold A and talk to C
 - When a hang-up, C and B will become no voice.
6. In some case, replaced call will cause the DSP crash
7. When an invite without any supported codec, it wills not response correctly. Now 415 is return.
8. In some case, the DSP will keep generating beep voice when the call is connected to FXO gateway and dial the DTMF. This patch will have workaround to disable the DTMF generation to caller.
9. When making a call and the remote party reply 200 OK without any 1xx, the DSP will crash.

Feature and Function Added

1. Added billing warning tone (support SIPPBX 6200 release 3.1 only)
2. Added an option to disable DND button (telnet only)
3. Customized ring tone frequency and cadence (telnet only)

Configuration Item Changed

1. Change the default group pick key to (*1)
2. Change the default specific pickup key to (*213)

Application Block Diagram

Hyperlink

WELLTECH WEB Site:

http://www.welltech.com/support/lanphone_388.htm

User Manual:

<http://www.welltech.com/support/voip2/SIP%20series/LP388/388%20User%20Guide%20Release%20103.zip>

Firmware Download:

<http://www.welltech.com/support/voip2/SIP%20series/LP388/Release%20103/LP388sip>

Note